


TEMPORARY STOCKPILE STABILIZATION NTS

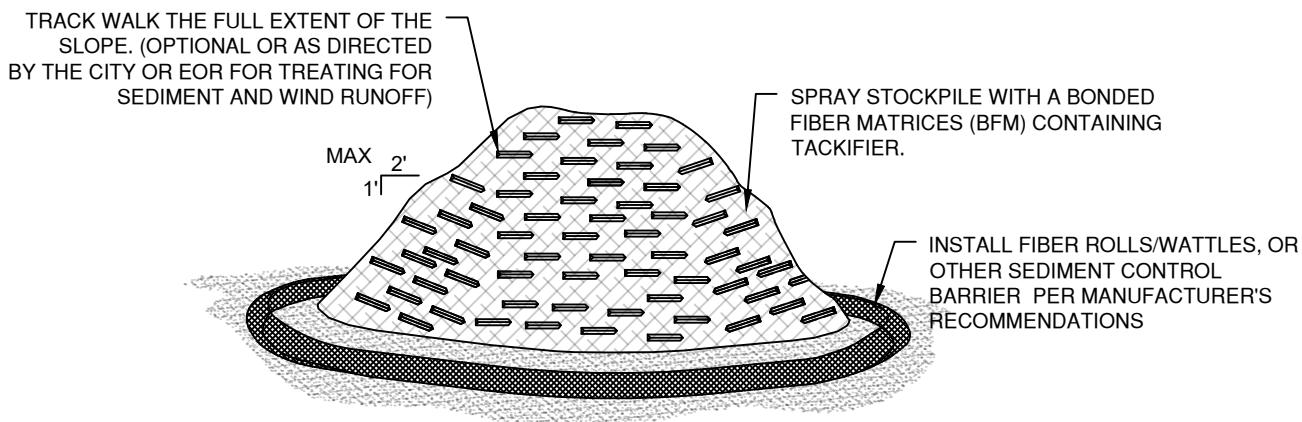

PERMANENT STOCKPILE STABILIZATION NTS

NOTES:

TEMPORARY STOCKPILE STABILIZATION:

1. INSTALL PLASTIC SHEETING VERTICALLY DOWN SLOPE.
2. INSTALL PLASTIC SHEETING SO EDGES OVERLAP AND ARE SHINGLED AWAY FROM PREVAILING WINDS.
3. PLASTIC SHEETING SHOULD ONLY BE UTILIZED AS REQUIRED BY THE CITY WHERE OTHER METHODS OF STOCKPILE STABILIZATION HAVE NOT PERFORMED.

INSPECTION AND MAINTENANCE:

1. INSPECT WEEKLY AND DAILY DURING STORM EVENTS
2. REPLACE TORN SHEETS AND REPAIR OPEN SEAMS.
3. COMPLETELY REMOVE ALL PLASTIC AND REPLACE WHEN IT BEGINS TO DETERIORATE.
4. COMPLETELY REMOVE PLASTIC WHEN IT IS NO LONGER NEEDED.
5. CHECK ANCHORING SYSTEMS AND REPAIR OR ADD ANCHORS.
6. VERIFY EFFECTIVE FUNCTION OF BMP AT TOE OF SLOPE.

DRAWN CJH	 CITY OF BEND	CITY OF BEND STANDARD DRAWING 710 NW WALL ST., BEND, OREGON 97701 STOCKPILE STABILIZATION	SCALE NTS
DIV EROSION			DATE 11/01/2024
REV DATE			APPR
			STD DWG E-5